

Date: Tuesday, 10/17/2006 11:03:28 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services
 Job Number : 29035
 Estimate Number : 10265
 P.O. Number : N/A
 This Issue : 10/17/2006 S.O. No. : N/A
 Prsht Rev. : NC
 First Issue : N/A Type : LANDING GEAR
 Previous Run : 29002
 Drawing Name : 350 SKIDTUBE ASSEMBLY RH
 Part Number : D350636012
 Drawing Number : D2750
 Project Number : N/A
 Drawing Revision : D
 Material : N/A
 Due Date : 11/10/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev: I 02-09-25 Rearranged procedure steps KJ
 Est Rev: J 06-03-29 As per Rev D EC
 Est Rev: J 06-07-13 As per dsi9343 EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 002

attached

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

DT 06-12-13

DT 06-12-13

3.0 D2744 Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

DT 06-12-14

BE 06-12-14

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

DT 06-12-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:28 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description:

4-Drill pilot holes for Detail B using DT8330

5-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" ***Make sure that wearplate holes are on bottom of tube*****

6-Open up holes of Detail A to 0.250" (total of 2 holes per side)

7- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

8-Countersink Detail A as per dwg D2750.

BE 06-12-14

9-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750.

10-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod m101446 BE 06-12-14

11-Grind welds flush as per Dwg D2750

BE 06-12-14

5.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

MOE/12/18

①

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

JOE/12/18

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

MOE/PMC 06-12-18

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 06-12-19

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Web

Batch:

29341

PM/ JB

06-12-19

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

D34901

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B28874

BE 06-12-20

11.0

D34903

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B29016

BE 06-12-20

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Crossbolt Spacer

Batch:

B27741

BE 06-12-20

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side)
as per dwg D2750.

pm 06-12-19 ①

2-Open up holes of Detail D to 0.750" (total of 4 holes per side)
as per dwg D2750.

pm 06-12-19 ①

3-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on sheet 4)

pm 06-12-19 ①

4-Deburr and blow out all chips from inside of tube

pm 06-12-19 ①

5-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

m102672

exp. date:

07-02-01

pm 06-12-19 - ①

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004
(welding instructions on sheet 4)

A/R

Aluminum Rod

batch:

m101446 BE 06-12-20

8-Grind welds flush as per Dwg D2750

pm 06-12-20 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750

Pm'06-12-20①

10-Deburr holes

Pm'06-12-20①

14.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

06/12/21 ①

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06/12/21 ①

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

06/12/28 ①

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

06/12/29

18.0

NAS1330S3KB166

INSERT



Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)

INSERT

Batch: 102644

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts as per dwg D2750

06/12/29

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

06/12/29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Wearpad

Batch: 28249

22.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: 27739

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: 28179

24.0

D2746

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: 285 28257

25.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: B 278628
2897420

26.0

D3488042

BLADE FITTING ASSEMBLY, RH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: 28319

am 07/06/23 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D3492041

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1329363

28.0

D3492043

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1327974

29.0

AN3C5A

Bolt



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Bolt

Batch: ~~18978~~ 102535

30.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: 19522

31.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: 102254

32.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M102966

33.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M102180

a.m 07/01/03

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

washer

Batch: 101340

35.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: Mh 100186

36.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M 101537

37.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M 100186

38.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

WASHER

Batch: 102404

39.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

WASHER

Batch: M102535

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch: M 101915

g.m

07/01/03

Q

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:30 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M102672

EXP DATE: 02/01

4-Coat all exposed fasteners with "LPS Procyon"

batch: M17168

02/01/03 (1)

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

FL 07 01 04 (1)

42.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: B28821 ✓

44.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M10956M100186 ✓

45.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M100186 ✓

46.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M102473 ✓

EPB 07/01/04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/17/2006 11:03:30 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 29035

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

47.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: *M102515* ✓

48.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

~~627894~~ 627835 ✓

49.0

D35321

spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

spacer

627894 ✓

CB 07/01/04

50.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

RV 7/01/04 (1)

51.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-012

REV: E

CB 07/01/04

52.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07.01.05

Job Completion



W 07.01.05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. D SHEET 1 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157	

RELEASED
06-02-07 *PH*

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
5	5	5	5	D2648-3	WEARPAD
1	1	1	1	D2656-13	WEARSHOE
1	1	1	1	D2656-35	WEARSHOE
1	1	1	1	D2746	WEARSHOE
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
2	2	2	2	AN8C21A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
4	4	4	4	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
3	3	3	3	MS21083C8	NUT
42	42	42	42	NAS1330S3KB166	INSERT
46	46	46	46	NAS1515H3L	WASHER
12	12	12	12	NAS1515H8L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29035

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED PH	DRAWING NO. D2750	REV. D SHEET 2 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

RELEASED
06.02.07

GENERAL NOTES:

 
 
1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ($\emptyset 0.250$ - $\emptyset 0.257$) FOR WEARSHOE INSERTS. C'SINK $\emptyset 0.391 \times 100^\circ$ AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES

SECTION
RETURN TO
ENGINEERING
MECHANICAL COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29035

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

02.02.07 #




SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29035

$\phi 0.625^{+0.010}_{-0.000}$
(8 PLACES)


- DETAIL B


0.500
(6 PLACES)


- DRILL 'E' (Ø0.250-Ø0.257) WEARSHOE HOLES
USING DRILL TEMPLATE DT8108-1
PER SECTION F-F (42 PLACES).
USE DT8108-2 FOR D2750-2. 1.770
C'SINK Ø0.391x100' WEARSHOE HOLES
(38 PLACES)
DO NOT C'SINK D3488-041/-042 HOLES

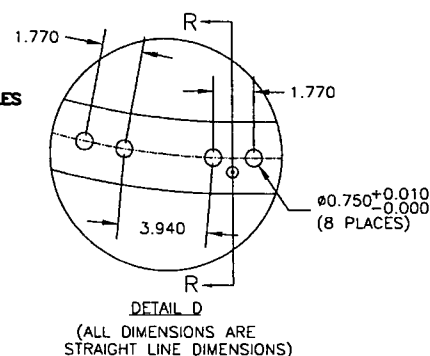


(ALL DIMENSIONS ARE
STRAIGHT LINE DIMENSIONS)

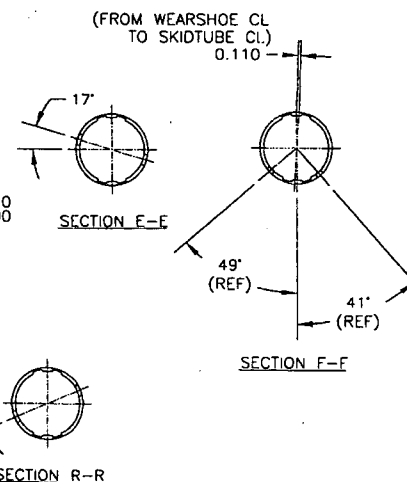



COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	 DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED #	APPROVED #	DRAWING NO. D2750	REV. D SHEET 3 OF 5
		DATE 06.01.05	TITLE 350 SKIDTUBE ASSEMBLY		

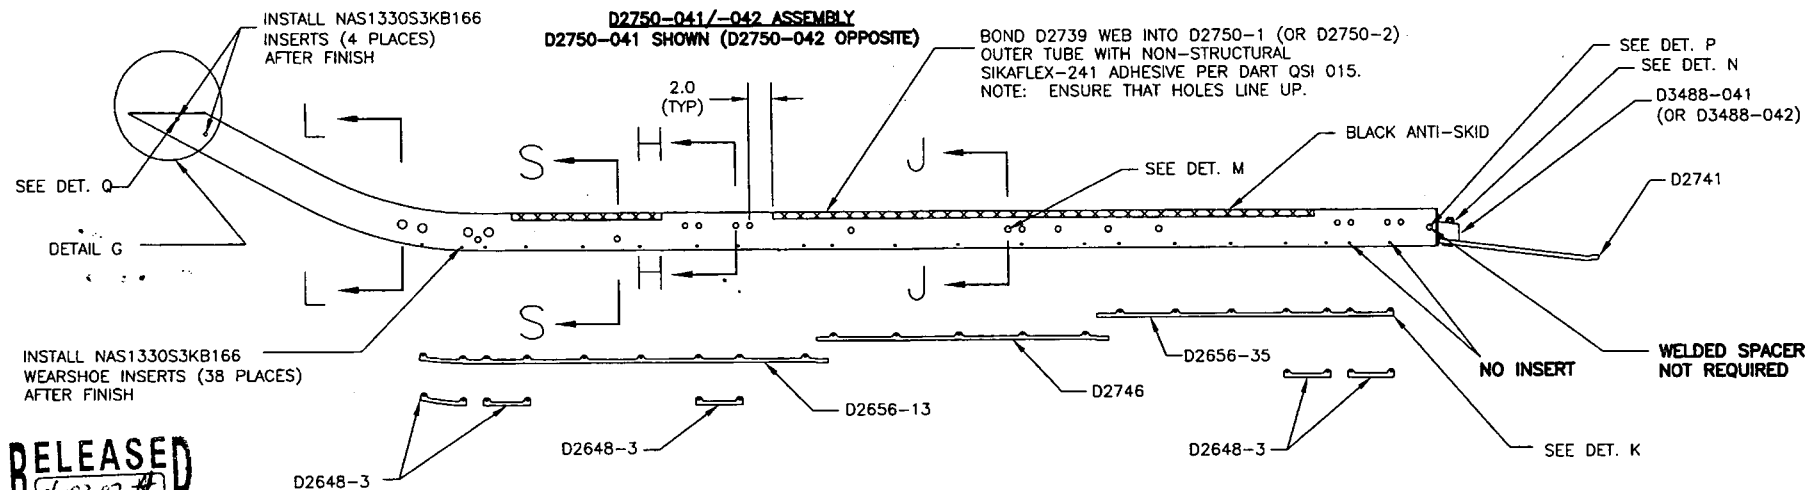

RELEASED
 06-02-07 #

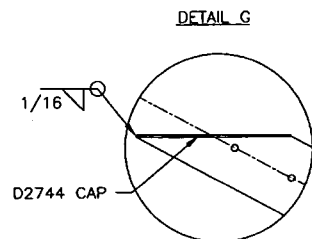

SECTION H-H D2743 SPACER (REF)

  

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

SECTION L-L

D3490-3 SPACER (TYP)

Ø0.750 HOLES ONLY

D3492-043 PLUG ASSEMBLY

SECTION S-S

D3490-1 SPACER (TYP)

Ø0.500 HOLES ONLY


D3492-041 PLUG ASSEMBLY

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO Ø0.750 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS


DETAIL K

USE AN3C7A BOLTS FOR INSTALLING AFT D2648-3 WEARPAD (4 PLACES)

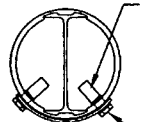


AN3C5A BOLT (1)
 AN960JD10L WASHER (1)
 NAS1515H3L WASHER (1)
 (38 PLACES)

 DETAIL M




AN6-44A BOLT (1)
 D2745 BUSHING (2)
 NAS1515H8L WASHER (2)
 MS21043-6 NUT (1)
 (4 PLACES)
NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING

DETAIL N

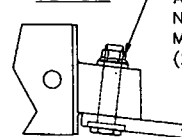


AN8C21A BOLT (1)
 AN960JD816L WASHER (1)
 NAS1515H8L WASHER (1)
 MS21083C8 NUT (1)
 (2 PLACES)

DETAIL P

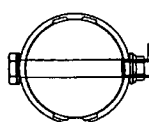

AN8C35A BOLT (1)
 AN960C816L WASHER (2)
 NAS1515H8L WASHER (2)
 MS21083C8 NUT (1)

DETAIL Q

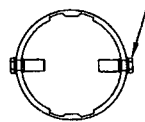



AN3C6A BOLT (1)
 AN960C10L WASHER (1)
 NAS1515H3L WASHER (1)
 (4 PLACES)

COPYRIGHT © 1996 BY DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	#	APPROVED	#	DRAWING NO. D2750
DATE	06.01.05	TITLE	350 SKIDTUBE ASSEMBLY	REV. D SHEET 4 OF 5 SCALE 1:20

NO. 29035
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY

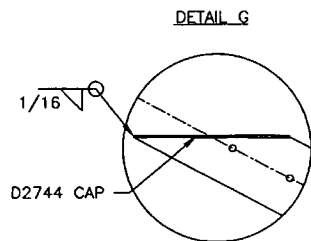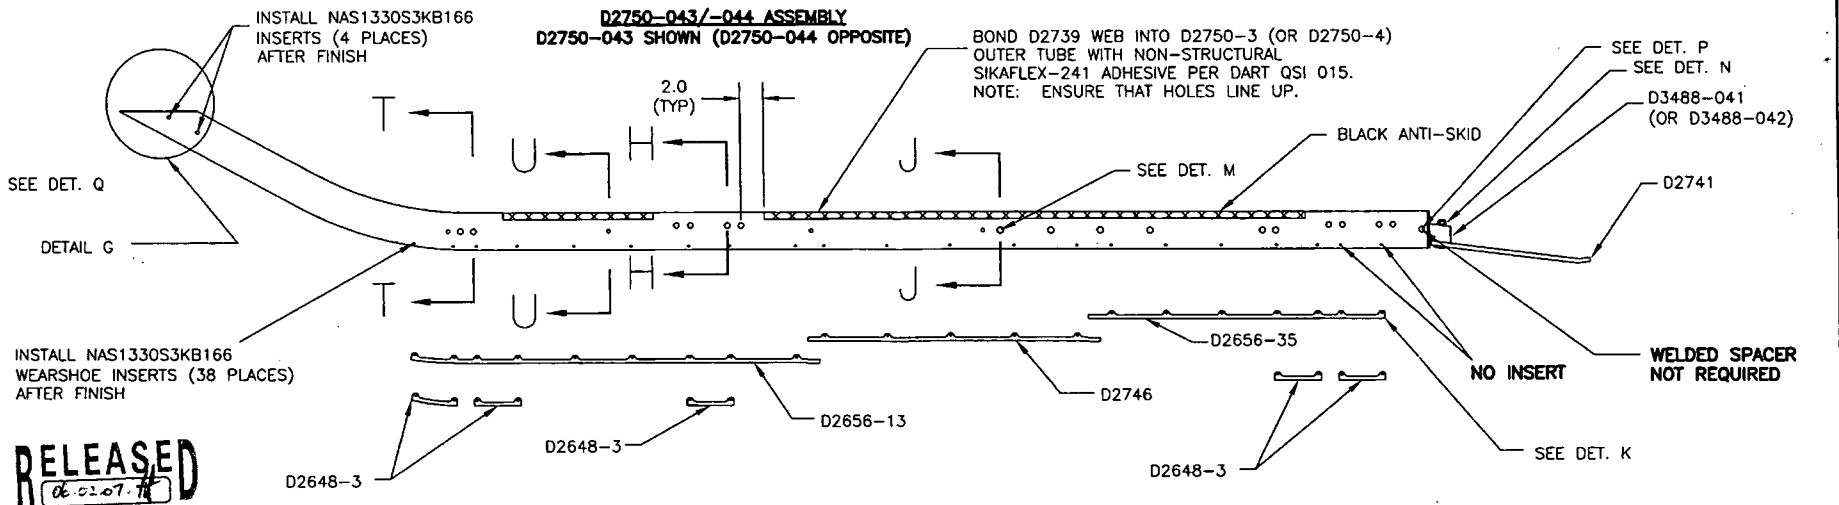


SECTION H-H D2743 SPACER (REF)

  

WELDING INSTRUCTIONS


1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

 DETAIL M



- AN6C44A BOLT (1)
D2745 BUSHING (2)
NAS1515H8L WASHER (2)
MS21043-6 NUT (1)
(4 PLACES)
NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING

 DETAIL Q



- AN3C6A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(4 PLACES)

SECTION T-T




SECTION U-U



WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS

DETAIL N

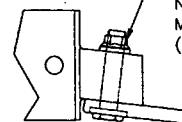

- AN8C21A BOLT (1)
AN960JD816L WASHER (1)
NAS1515H8L WASHER (1)
MS21083C8 NUT (1)
(2 PLACES)

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, VA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED PH	APPROVED PH	DRAWING NO. D2750	REV. D
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY		SHEET 5 OF 5 SCALE 1:20	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 24035

NO. 82

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A350 636 011/B29428

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into _____ Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/12/18 Qualifier David David

Date: Tuesday, 10/17/2006 11:03:28 AM
 User: Kim Johnston

Process Sheet

45

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 350 SKIDTUBE ASSEMBLY RH
Job Number : 29035	
Estimate Number : 10265	
P.O. Number :	Part Number : D350636012
This Issue : 10/17/2006 S.O. No. :	Drawing Number : D2750
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : LANDING GEAR	Drawing Revision : D
Previous Run : 29002	Material :
Written By :	Due Date : 11/10/2006 Qty: 1 Um: Each
Checked & Approved By : <u>KA 06 10 17</u>	
Comment : Est Rev: I 02-09-25 Rearranged procedure steps KJ Est Rev: J 06-03-29 As per Rev D EC Est Rev: J 06-07-13 As per dsi9343 EC	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 002

06 10 18 KA

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-3-Bent Extrusion (Bent)

3.0	D2744	Fwd Cap
-----	-------	---------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: _____

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

REFERENCE ONLY